


1. No flush C200S/CS

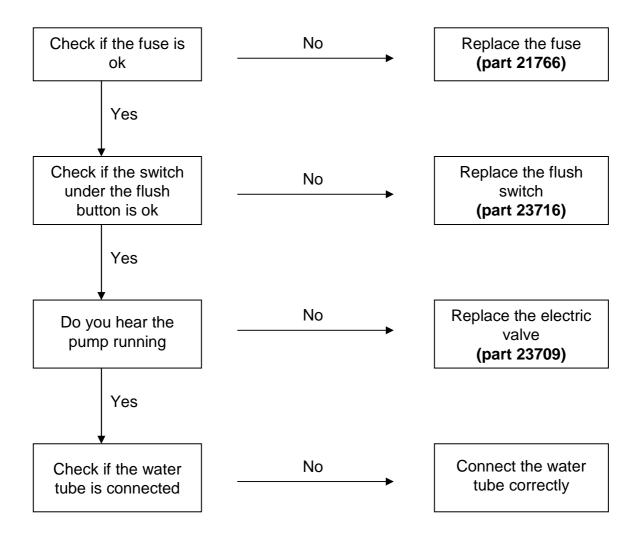

Before starting, check if the toilet is well connected see the 12V connection scheme






Repair instructions you can find in the repair instructions chapter and/or on our website www.thetford.eu





1. No flush C200CW

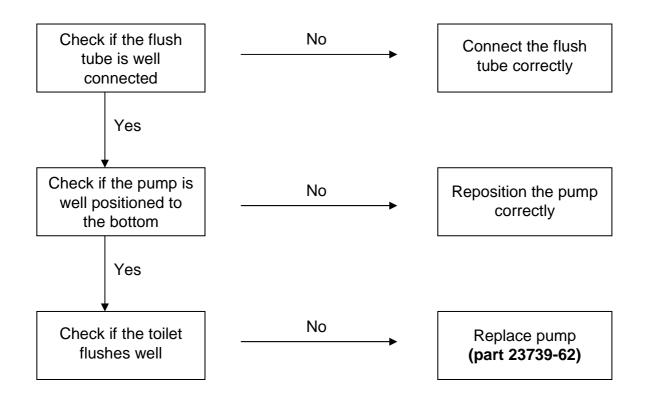



Repair instruction for 23739-62 you can find in the repair instructions chapter and/or on our website www.thetford.eu






1. No flush C200CWE



Before starting, check if the toilet is well connected see the 12V connection scheme

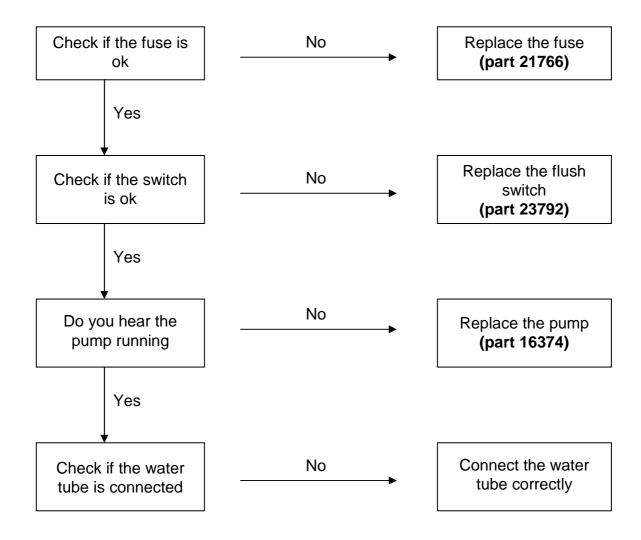



Repair instructions you can find in the repair instructions chapter and/or on our website www.thetford.eu






2. No level indication of the C200 Holding Tank



Before starting, Check the connection wires at the control panel

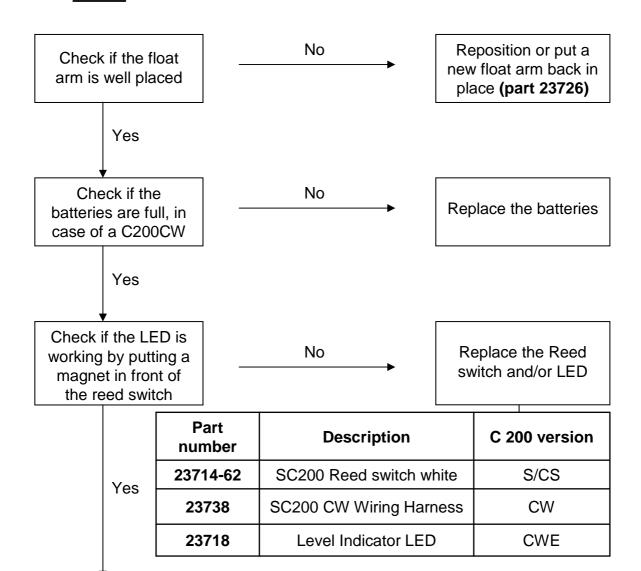

Reposition the reed switch closer to the holding tank






No flush C250CS

Ensure that the vehicle water pump functions




Before starting, check if the toilet is well connected see the 12V connection scheme

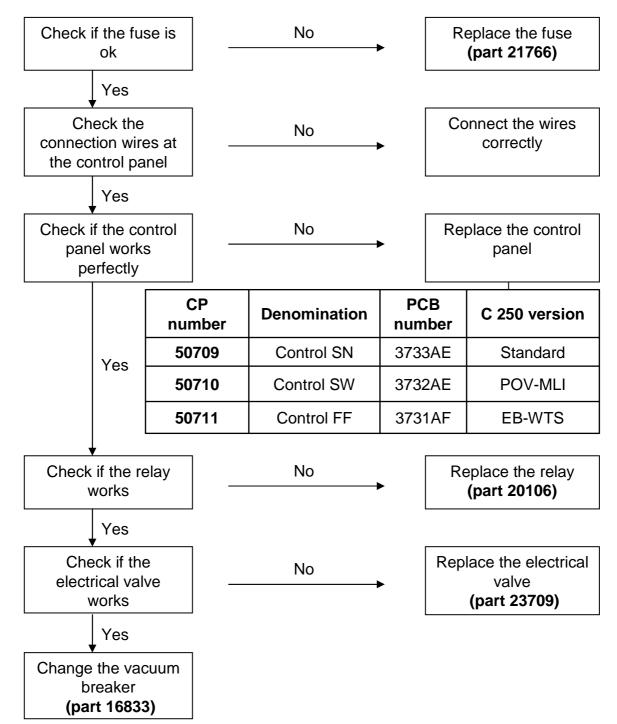

6.101 1/4 05/09




No level indication of the C250 Holding Tank

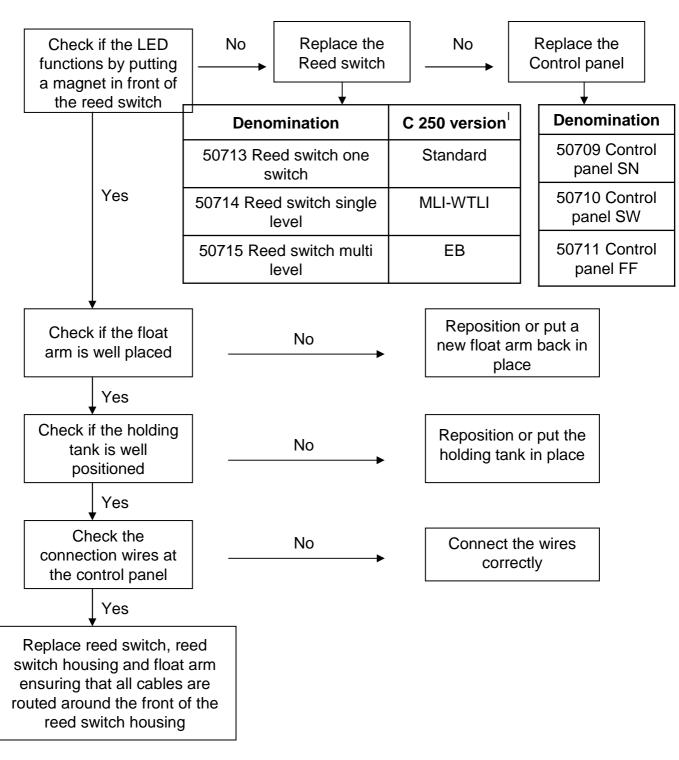

6.101 2/4 05/09



> Leakage between the bowl and the Holding Tank

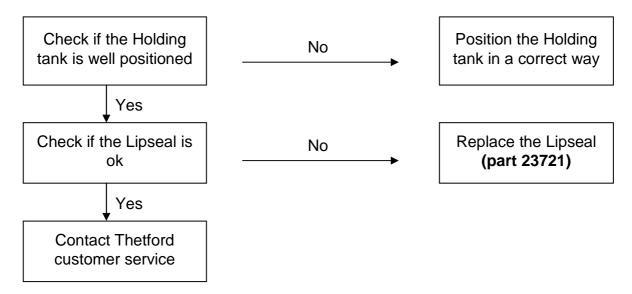

- Leakage at the Holding tank
 - Leakage at the vent button

Replace the vent button (part 07524-92)

Leakage at the pour out spout

Replace the pour out spout (part 50719-92)

Leakage at the holding tank plate

Replace the Lipseal (part 23721)

6.101 3/4 05/09



Blade does not close off the holding tank C250

issue : Blade shoots over the plate seal and do not close off the

holding tank

Solution : Rib on plate seal higher to stop the blade

Implementation : September 6th 2007

Spare part nr. : 50727-06

Compensation : 5 minutes



Wheels holding tank C250

issue : Wheels flip when pushing, pulling is ok

Solution : Tool change by adding ribs to the wheel to minimize flexing of the

wheels

Implementation : September 1st 2007

Spare part nr. : 50726

Compensation : 5 minutes






No flush C250 CWE




Before starting, check if the toilet is well connected see the 12V connection scheme

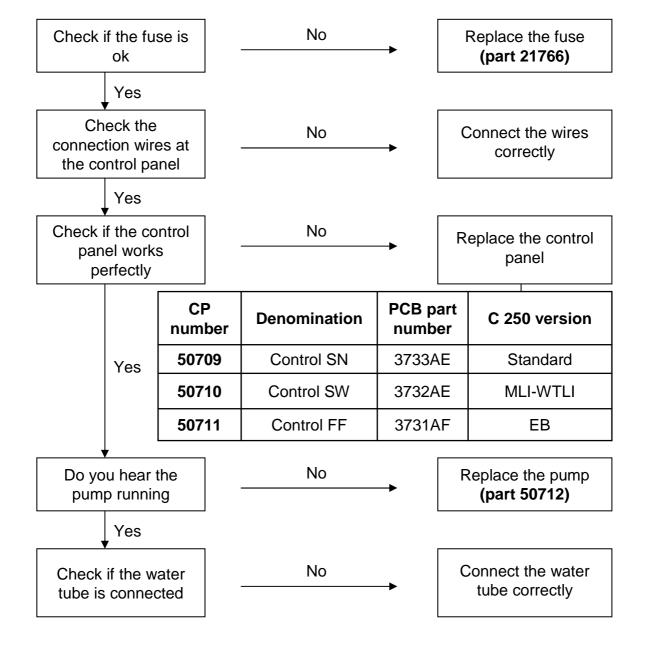

6.102 1/6 05/09




No level indication of the C250 Holding Tank

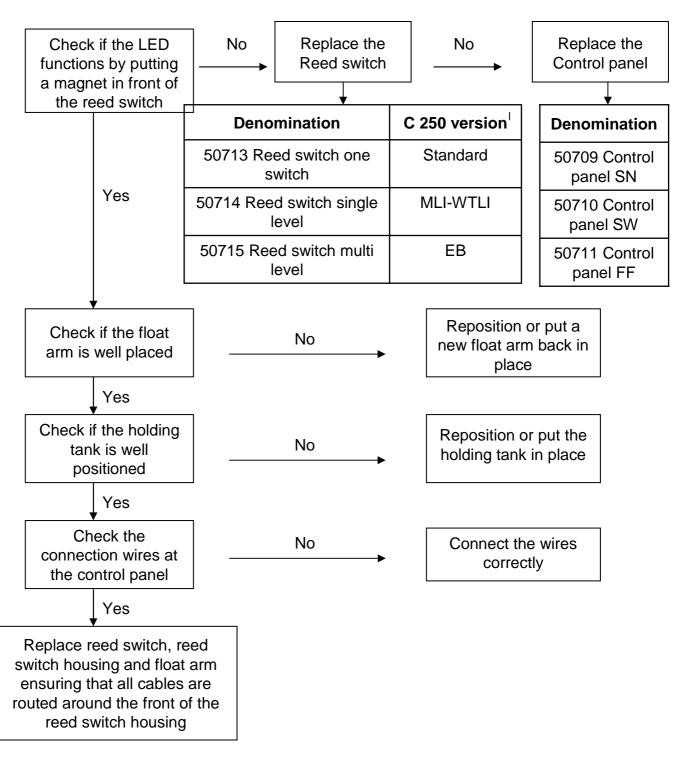




Leakage between the bowl and the Holding Tank

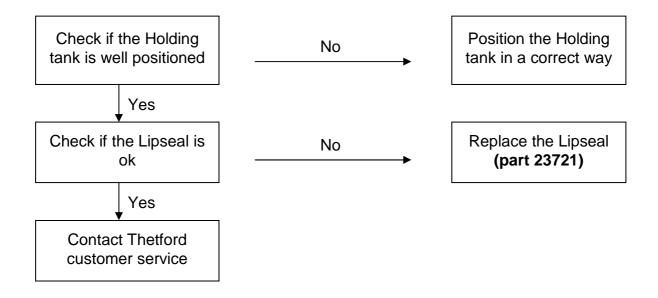

Leakage at the water tank

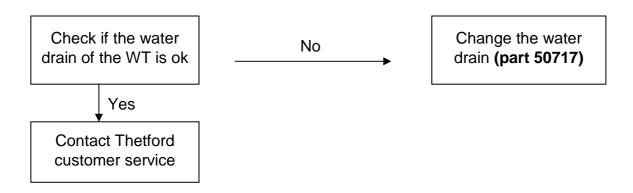



> Leakage at the Holding tank

Leakage at the vent button

Replace the vent button (part 07524-92)

Leakage at the pour out spout

Replace the pour out spout (part 50719-92)

Leakage at the holding tank plate

Replace the Lipseal (part 23721)

6.102 4/6 05/09



Leakage pump C250CWE

Issue : Leakage at welded connection between pump-housing and

pump bracket

Solution : More rigid tube connection and clamp have been added

Implementation : As from September 24 2007





Blade does not close off the holding tank C250

issue : Blade shoots over the plate seal and do not close off the

holding tank

Solution : Rib on plate seal higher to stop the blade

Implementation : September 6th 2007

Spare part nr. : 50727-06

Compensation : 5 minutes



Wheels holding tank C250

issue : Wheels flip when pushing, pulling is ok

Solution : Tool change by adding ribs to the wheel to minimize flexing of the

wheels

Implementation : September 1st 2007

Spare part nr. : 50726


Compensation : 5 minutes





No flush C250S


Ensure that the vehicle water pump functions

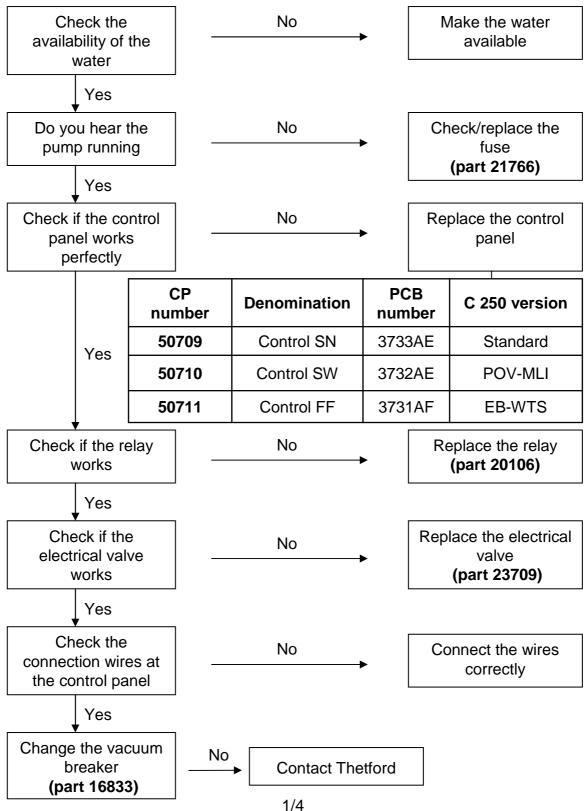

6.100 05/09




No level indication of the C250 Holding Tank

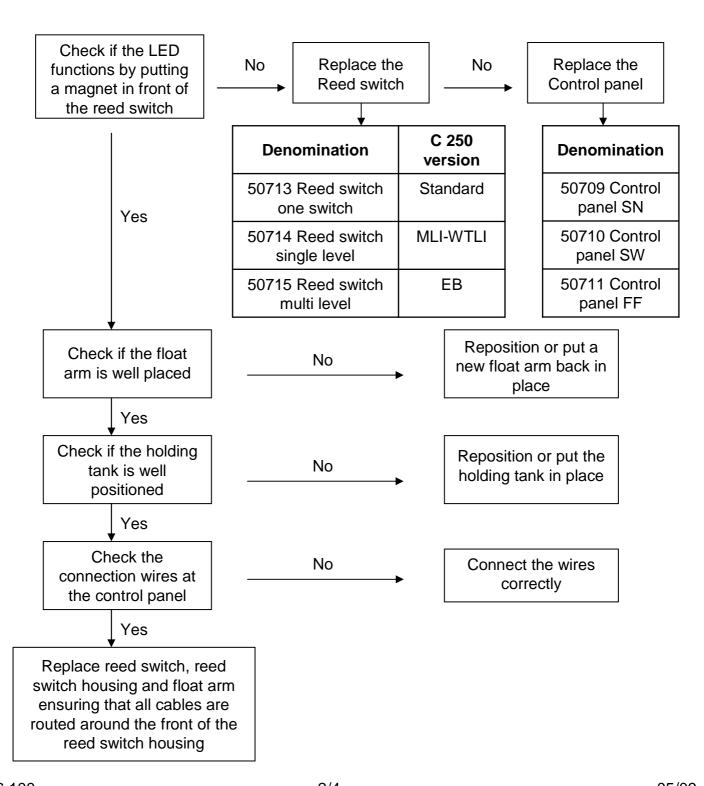



Leakage between the bowl and the Holding Tank

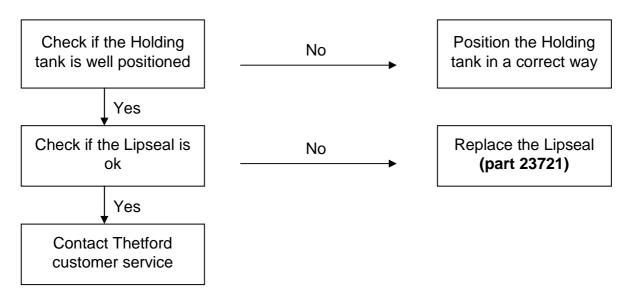

- Leakage at the Holding tank
 - Leakage at the vent button

Replace the vent button (part 07524-92)

Leakage at the pour out spout

Replace the pour out spout (part 50719-92)

Leakage at the holding tank plate

Replace the Lipseal (part 23721)

6.100 3/4 05/09



Blade does not close off the holding tank C250

issue : Blade shoots over the plate seal and do not close off the

holding tank

Solution : Rib on plate seal higher to stop the blade

Implementation : September 6th 2007

Spare part nr. : 50727-06

Compensation : 5 minutes



Wheels holding tank C250

issue : Wheels flip when pushing, pulling is ok

Solution : Tool change by adding ribs to the wheel to minimize flexing of the

wheels

Implementation : September 1st 2007


Spare part nr. : 50726

Compensation : 5 minutes





No flush C402C

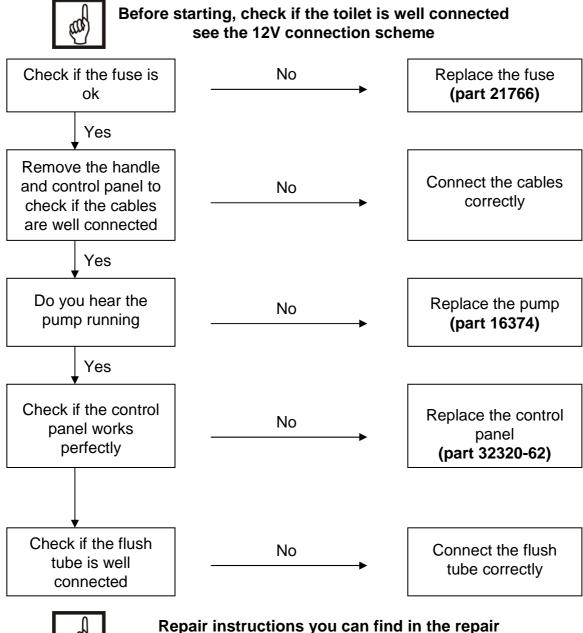


Repair instructions you can find in the repair instructions chapter and/or on our website www.thetford.eu

6.200 1/4 05/09




No level indication of the C400 Holding Tank

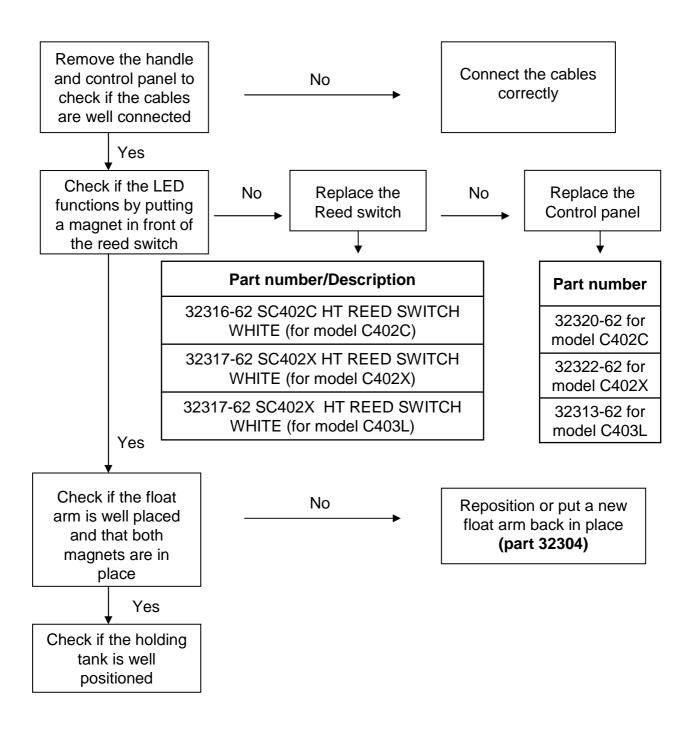


6.200 2/4 05/09



Leakage between the bowl and the Holding tank

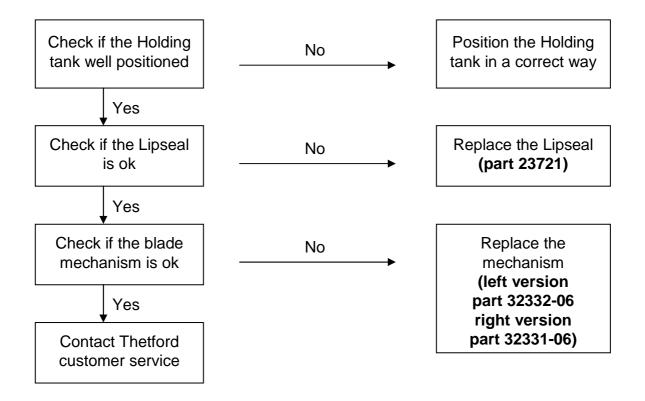

Leakage at the Water tank

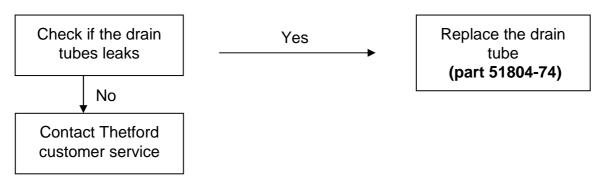

6.200 3/4 05/09




- > Leakage at the Holding tank
 - Leakage at the vent button

Replace the vent button (part 32307-16)

Leakage at the pour out spout

Replace the pour out spout (part 32306-06)


Leakage at the vent lid

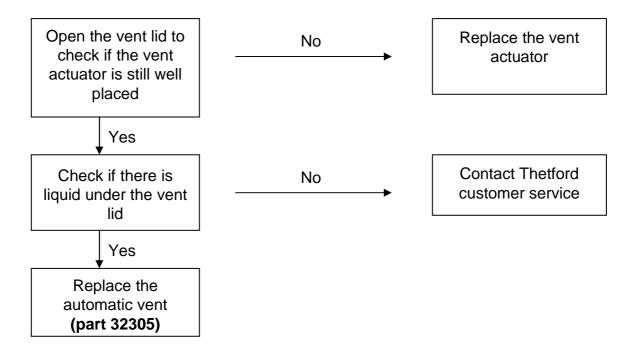

6.200 4/4 05/09



No flush C402X

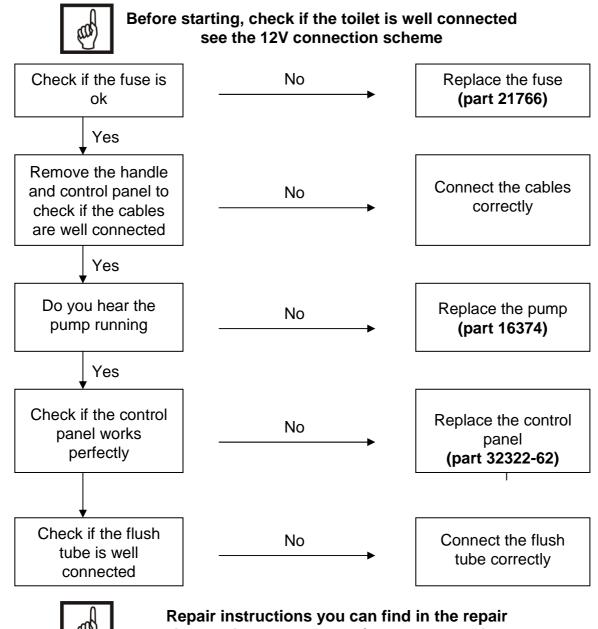


instructions chapter and/or on our website www.thetford.eu

6.201 1/5 05/09




No level indication of the C400 Holding Tank

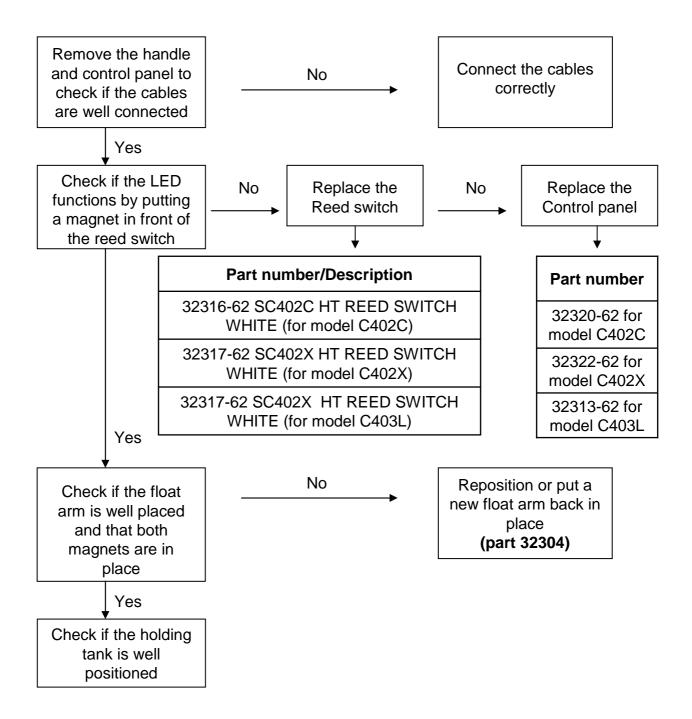




No level indication of the C402X Water tank

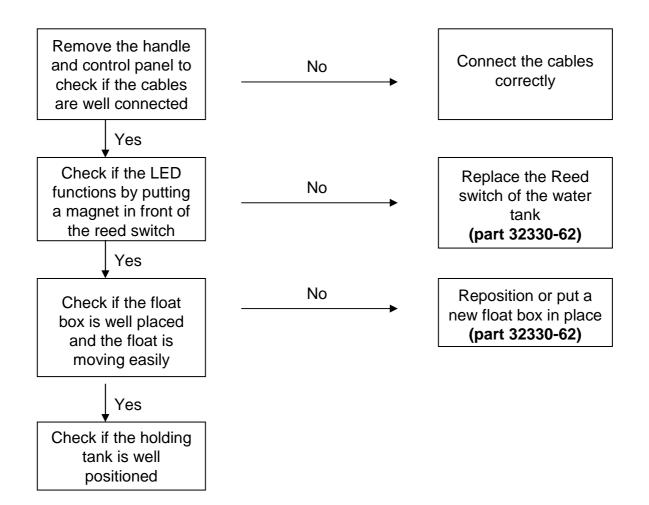


6.201 3/5 05/09



Leakage between the bowl and the Holding tank

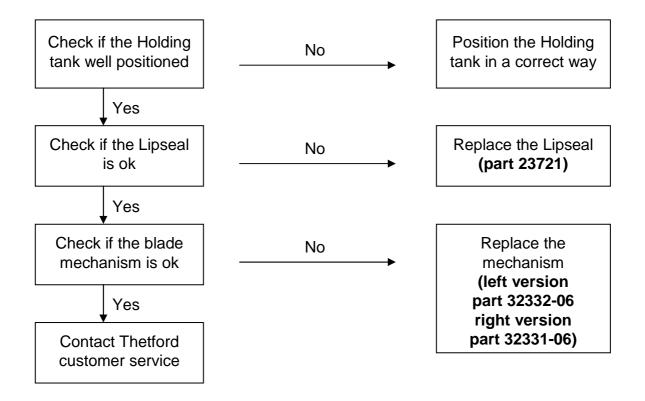

Leakage at the Water tank

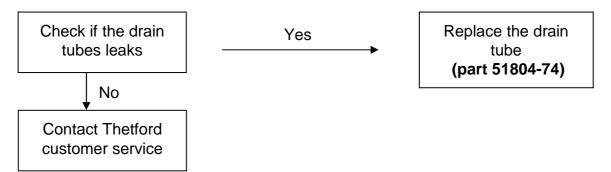

6.201 4/5 05/09




- > Leakage at the Holding tank
 - Leakage at the vent button

Replace the vent button (part 32307-16)

Leakage at the pour out spout

Replace the pour out spout (part 32306-06)

Leakage at the vent lid

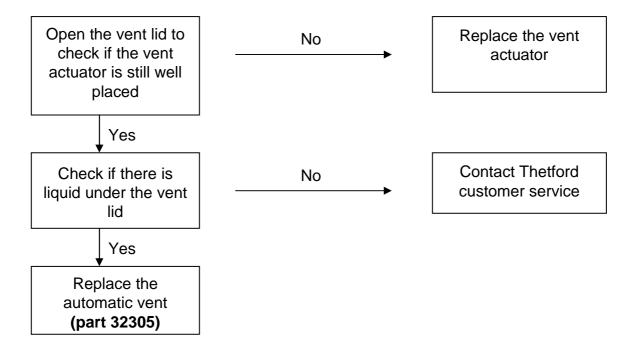




No flush C403L



Before starting, check if the toilet is well connected, water is available and the vehicle pump is working well. See the 12V connection scheme

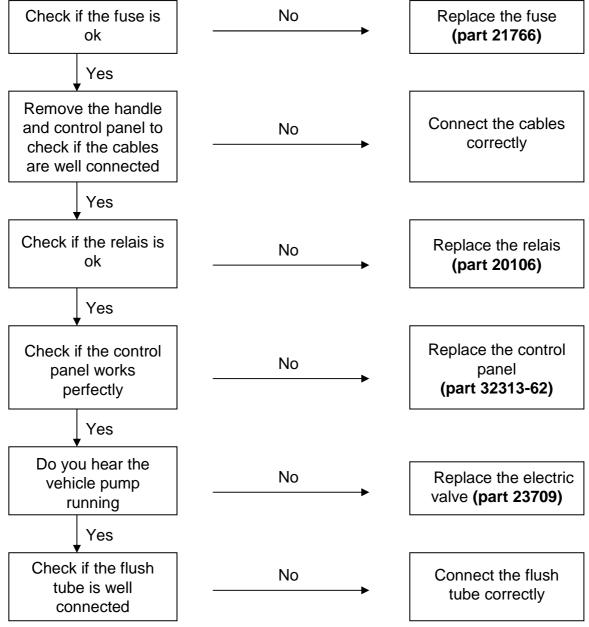


and s

Repair instructions you can find in the repair instructions chapter and/or on our website www.thetford.eu

6.202 1/4 05/09




No level indication of the C400 Holding Tank

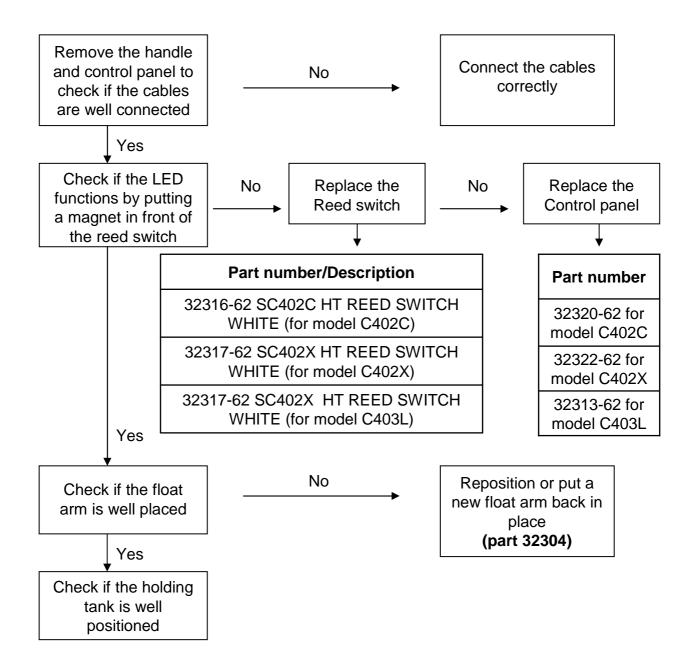

6.202 2/4 05/09



Leakage between the bowl and the Holding tank

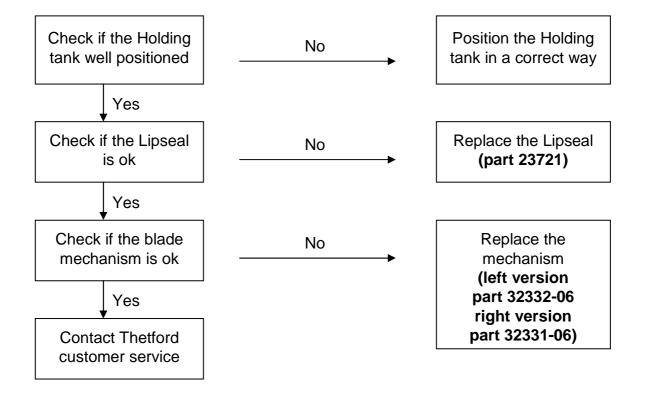

6.202 3/4 05/09



Leakage at the Holding tank


Leakage at the vent button

Replace the vent button (part 32307-16)

Leakage at the pour out spout

Replace the pour out spout (part 32306-06)

Leakage at the vent lid

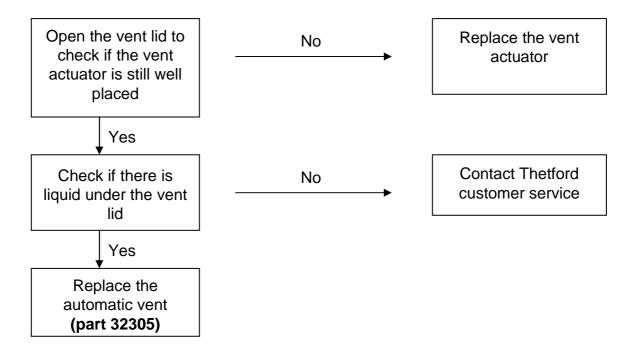


6.202 4/4 05/09



No flush C500C



Before starting, ensure that the toilet is connected properly by checking the 12v diagram. Also ensure that the fresh water tank is full.

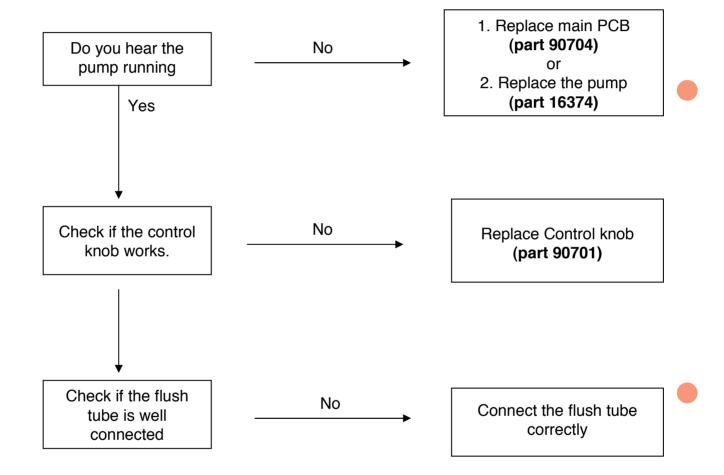




Repair instructions you can find in the repair instructions chapter and/or on our website www.thetford.eu

6.203




No level indication of the C500 Waste-Holding Tank

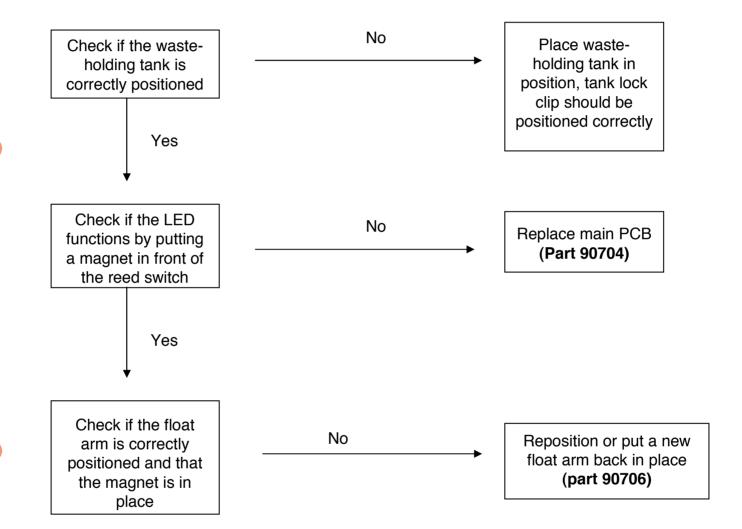




Leakage between the bowl and the Waste-Holding tank

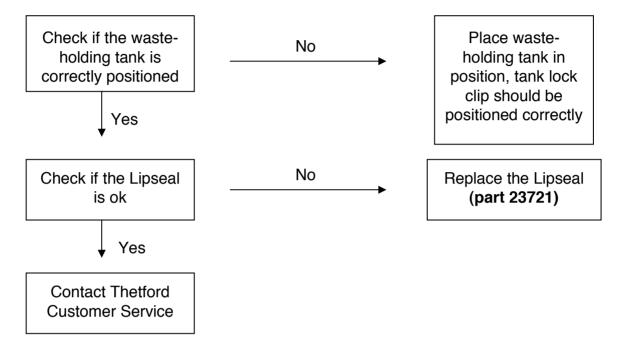

Leakage at the Water tank

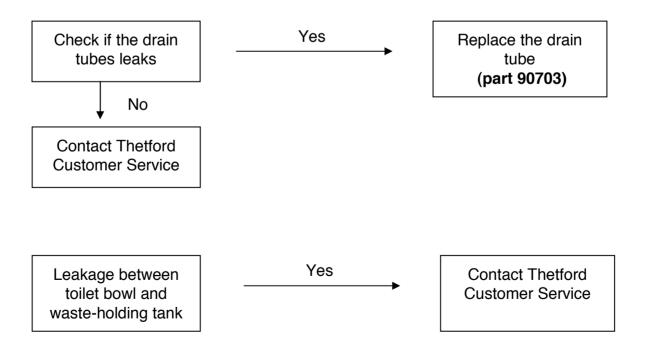



- > Leakage at the Waste-Holding tank
 - Leakage at the vent button

Replace the vent button (part 32307-16)

Leakage at the pour out spout

Replace the pour out spout (part 32306-06)

Leakage at the automatic vent

